



PRODUCT COMPARISON

0488C vs. 0488L



It's Better with Kason.

0488C

Walk-In Push Bar Inside Release



U.S. Patent No. 11,193,311

- Large hands-free contact area to open door
- Ergonomic design provides simple low-effort operation
- Stainless steel and aluminum materials for non-corroding construction
- Accommodates left and right-handed doors
- Retrofit mounting plate provides secure attachment to door without backing material inside
- Works with Kason latches listed below

Part No.	Latches	Door Thickness	Thru Rod Length	Wgt./Carton
10488C00318300	0058, 0077, 0078, 0778	3" (76.2 mm)	6.46" (164.1 mm)	5.98 lb (2.71 kg)
10488C00318400	0058, 0077, 0078, 0778	4" (101.6 mm)	7.46" (189.5 mm)	6.04 lb (2.74 kg)
10488C00318500	0058, 0077, 0078, 0778	5" (127 mm)	8.46" (214.9 mm)	6.09 lb (2.76 kg)
10488C00318600	0058, 0077, 0078, 0778	6" (152.4 mm)	9.46" (240.3 mm)	6.14 lb (2.79 kg)

Note: See the Kason [Walk-In catalog](#) for complete list of compatible latches and strikes.

UL 305 and CAN/ULC-S132 Certified

0488L

Panic Bar Inside Release and Latch Assembly




U.S. Patent No. 11,193,311

- Includes 0778 latch and 0779 strike
- Large hands-free contact area to open door
- Ergonomic design provides simple low-effort operation
- Stainless steel and aluminum materials for non-corroding construction
- Accommodates left and right-handed doors

Part No.	Latch	Strike	Door Thickness	Thru Rod Length	Wgt./Carton
10488LC175302	0778	0779	1-1/2" to 1-3/4" (38.1 to 44.5 mm)	4.87" (123.7 mm)	12.72 lb (5.77 kg)
10488LC200302	0778	0779	2" to 2-1/4" (50.8 to 57.2 mm)	5.19" (131.8 mm)	12.75 lb (5.78 kg)
10488LC225302	0778	0779	2-1/4" to 2-1/2" (57.2 to 63.5 mm)	5.63" (143 mm)	12.78 lb (5.8 kg)
10488LC300302	0778	0779	3" to 3-1/4" (76.2 to 82.6 mm)	6.46" (164.1 mm)	12.81 lb (5.81 kg)
10488LC350302	0778	0779	3-1/2" to 3-3/4" (88.9 to 95.3 mm)	6.94" (176.3 mm)	12.84 lb (5.82 kg)
10488LC400302	0778	0779	4" to 4-1/4" (101.6 to 108 mm)	7.46" (189.5 mm)	12.87 lb (5.84 kg)
10488LC425302	0778	0779	4-1/4" to 4-1/2" (108 to 114.3 mm)	7.71" (195.8 mm)	12.9 lb (5.85 kg)
10488LC500302	0778	0779	5" to 5-1/4" (127 to 133.4 mm)	8.46" (214.9 mm)	12.93 lb (5.86 kg)

Note: Kason 0779 strike and 0778 latch are protected by intellectual property rights through the USPTO.

Understanding the Differences

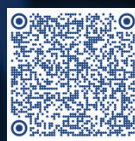

Features	0488C	0488L
Latch and strike included	–	☑
NSF certified	☑	☑
Large hands-free contact area	☑	☑
Ergonomic design for simple, low-effort operation	☑	☑
Stainless steel and aluminum materials	☑	☑
Accommodates left and right handed doors	☑	☑
Retrofit plate mounting	☑	☑
Applications	Walk-in	Industrial enclosures, sound rooms, generator rooms
Standards	NSF Component	NSF Component, UL 305 and CAN/ULC-S132

Frequently Asked Questions

What other standards does the 0488L meet?

- Canada's CAN/ULC-S132
- Standard Method of Tests for Emergency Exit and Emergency Fire Exit Hardware
- California Building Code Sec. 11B-309.4

Can UL-certified components be purchased separately?

No. To maintain UL305 certification, the latch, strike, and inside release are tested and approved as a complete assembly and are sold as a set. However, replacement components are available if a part becomes damaged or requires service.

Can I use a different latch with the 0488L Panic Device?

No. The 0488L Panic Device and its latch were tested and certified together to meet UL305 requirements. To maintain compliance, only the approved latch should be used.

What prevents the 0488C crossbar from being used with the 0488L system?

UL 305 requires critical parts materials to have a solidus temperature of at least 1,000°F. The nylon parts used in the 0488C do not meet this requirement.

Is there a retrofit option for the 0488C and 0488L Panic Devices?

Yes, retrofit options are available for both. Visit the product landing pages below to learn more.

What is the UL 305 standard?

Requirements for panic hardware, fire exit hardware, and exit locks with a crossbar, push pad, or paddle actuator on outward-opening doors, designed to enable safe emergency egress.

Are there replacement parts available for 0488L?

Yes, replacement parts are available for the 0488C and 0488L. Please contact your Kason representative for replacement information.



What Sets Us Apart

- Proven industrial performance
- Advanced custom capabilities
- Decades of application expertise
- Patents and trademarks to protect against counterfeits
- Vertically integrated manufacturing
- Global sourcing flexibility



Corporate Headquarters

57 Amlajack Blvd
Newnan, GA 30265
800.935.2766
info@kasonind.com

Kason Vinyl Division

31 Amlajack Blvd
Newnan, GA 30265
800.472.7450
vinyl@kasonind.com

Kason Central

8889 Whitney Drive
Lewis Center, OH 43035
740.549.2100
central@kasonind.com

Kason Canada

226 Industrial Pkwy. N., Unit 2
Aurora, ON, Canada
L4G 4C3
905.713.6515
canada@kasonind.com

Kason Foodservice Division

31 Amlajack Blvd
Newnan, GA 30265
866.231.2157
fssales@kasonind.com

Kason Western

1500 E. Wooley Road
Oxnard, CA 93030
805.247.1088
western@kasonind.com

Kason Mid-America

1239 Atlantic Street
N. Kansas City, MO 64116
816.472.7450
midamerica@kasonind.com

Oxford Hardware

Burland House, Oxhill CV35 ORD,
United Kingdom
+44 01295 680068
sales@oxfordhardware.co.uk
oxfordhardware.co.uk

International Sales

770.304.3000
international@kasonind.com